

Fire Alarm and Life Safety System Inspection Report

For

Kerry's Place

Building Number: 1543575

Tested to CAN/ULC S536-04 Standard
Smoke alarms are inspected to CAN ULC S553-02

This report should be accompanied by the BRForm containing the contents of CAN/ULC S536-04 Appendix E

This Inspection was performed in accordance with applicable ULC Standards. The subsequent pages of this report provide performance measurements, listed ranges of acceptable results, and complete documentation of the inspection. Whenever discrepancies exist between acceptable performance standards and actual test results, notes and/or recommended solutions have been proposed or provided for immediate review and approval.


The devices in this report are 100% tested and 96% passed

Annual Inspection

Start Date: Oct 20, 2025

End Date: Oct 20, 2025

Service - Tested/Cleaned

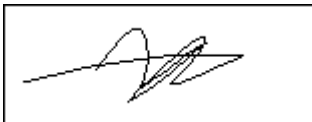

Building: Kerry's Place
Contact: MAIN .



Company: Georgian Bay Fire & Safety - Peterborough
Contact: Derek Rennie

To obtain further details about this inspection please utilize your login and password to view online.
This FireScan report should be accompanied with the associated BRForm.

Fire Alarm Testing Report

Executive Summary

Generated by: BuildingReports.ca

Building Information

Building: Kerry's Place

Contact: MAIN .

Address:

Phone: .

Address:

City/Province/Postal Code:

Email: accountspayable@kerrysplace.org

Inspection Performed By

Company: Georgian Bay Fire & Safety - Peterborough

Inspector: Derek Rennie

Address: 347 Pido Road

Phone: 1-800-265-3197

Address: Unit 19

City/Province/Postal Code: Peterborough, Ontario K9J 6X7

Email: derek.rennie@fire-sp.com

System Control Unit

Manufacturer: Mircom

Inspection Date: 10/20/2025

IDC Style: B

Model Number: FA-1000

Install Date: 10/28/2024

SLC Style:

Software Version:

Version Date: 10/29/2024

NAC Style: B

Location: Main FACP In Tank Room

Current Protection: Breaker

**Auto Evac
Time:**


Certification

Company: Georgian Bay Fire & Safety - Peterborough

Building: Kerry's Place

Inspector: Derek Rennie

Contact: MAIN .

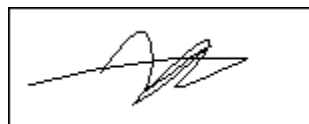

Signed: Oct 20, 2025

Signed: Oct 20, 2025

Discrepancy Report with Proposed Solutions

Generated by: BuildingReports.ca

Building: Kerry's Place									
<i>This report consolidates all discrepancies and provides proposed solutions to these issues. Discrepancies are listed by Category, and grouped by device type. The description of the problem is provided and where appropriate, code references are listed for your convenience. Any devices that have been corrected and passed the retest are checkmarked under the Fixed column and details regarding the individual who completed the fix are noted in the last column. Any item that was inspected that is subject to a recall or part of a manufacturer's replacement/upgrade program is included.</i>									
Device Type		Manufacturer		Model Number		Date		Qty	
Items listed for Recall or Replacement/Upgrade									
No items found during this inspection.									
Scan Number		Model	Type/Size	Discrepancy	Solution	Cost	A P P R O V E D	F I X E D	Date Corrected and Passed Retest
Smoke Detector									
A0248100		C2W-BA	Photoelectric	Failed Test CAN/ULC S536 5.7.4.1.2	Replace w/ C2W-BA	T/M	☐	☐	

Location: Basement Room #1 West- Bed Room (Barcode on Doorframe) **Note:**

Total Cost (excluding taxes): T/M

Customer WO/PO #: (none)

Internal WO/PO #: (none)

Individual Device Record

Generated by: BuildingReports.ca

Type of Inspection: Fire Alarm System Annual Inspection and Test (ULC S536-04)

Building Name: Kerry's Place

Inspection Date and Time: 10/20/25 10:56:35 AM

Inspector: Derek Rennie

Note: The Location Column includes the location, time and date of the inspection and barcode number.

Remarks Column: Detector sensitivity in percentage and Waterflow Switch time delay in seconds.

For specific output circuit operation confirmation see associated BRForm section - "Ancillary Function Testing"

Location	Device Type	Correctly Installed	Requires Service, Repairs, Cleaning or Missing	Alarm Operation Confirmed	Annunciation Indication Confirmed	Zone Circuit Number or Address	Supervision of Wiring Device Confirmed	Ground Circuit Confirmed	Remarks/ Readings
Tested									
1st Floor At Hallway Ending East, 10:36:27AM 10/20/2025 (A0245420)	Horn/Strobe	☒	☐	☒	☐	1-NAC	☐	☐	LTD 10/20 /2025
1st Floor At Rear Exit, 10:42:48AM 10/20/2025 (A0245460)	End Of Line	☒	☐	☒	☒	1-1	☒	☒	LTD 10/20 /2025
1st Floor Living Room, 10:43:55AM 10/20/2025 (A0245424)	Horn/Strobe	☒	☐	☒	☐	1-NAC	☐	☐	LTD 10/20 /2025
1st Floor Main Entrance, 10:21:30AM 10/20/2025 (A0248089)	Pull Station	☒	☐	☒	☒	1-1	☐	☐	LTD 10/20 /2025
1st Floor Rear Entrance, 10:42:00AM 10/20/2025 (A0248105)	Pull Station	☒	☐	☒	☒	1-1	☐	☐	LTD 10/20 /2025
1st Floor Top of Main Stair, 10:29:05AM 10/20/2025 (A0248122)	Smoke Detector	☒	☐	☒	☒	1-1	☐	☐	ST, LTD 10 /20/2025
1st Floor At Kitchen (Barcode on Doorframe), 10:43:23AM 10/20 /2025 (A0245423)	Heat Detector	☒	☐	☒	☒	1-1	☐	☐	LTD 10/20 /2025
1st Floor Hallway East (Barcode on Doorframe), 10:38:04AM 10 /20/2025 (A0245421)	Smoke Detector	☒	☐	☒	☒	1-1	☐	☐	ST, LTD 10 /20/2025
1st Floor Office North (Barcode on Doorframe), 10:39:30AM 10 /20/2025 (A0248093)	Smoke Detector	☒	☐	☒	☒	1-1	☐	☐	ST, LTD 10 /20/2025
1st Floor Room #1 South/East (Barcode on Doorframe), 10:41: 25AM 10/20/2025 (A0245422)	Smoke Detector	☒	☐	☒	☒	1-1	☐	☐	ST, LTD 10 /20/2025

Location	Device Type	Correctly Installed	Requires Service, Repairs, Cleaning or Missing	Alarm Operation Confirmed	Annunciation Indication Confirmed	Zone Circuit Number or Address	Supervision of Wiring Device Confirmed	Ground Circuit Confirmed	Remarks/ Readings
1st Floor Room #2 East (Barcode on Doorframe), 10:40:33AM 10/20/2025 (A0248092)	Smoke Detector	☒	☐	☒	☒	1-1	☐	☐	ST, LTD 10 /20/2025
1st Floor Living Room (Barcode on Kitchen Doorframe), 10:44:37AM 10/20/2025 (A0245425)	Smoke Detector	☒	☐	☒	☒	1-1	☐	☐	ST, LTD 10 /20/2025
East House Annunciator Main Entrance, 10:21:11AM 10/20 /2025 (A0248088)	Annunciator	☒	☐	☐	☐	1	☐	☐	LTD 10/20 /2025
Main FACP In Tank Room, 10:52:33AM 10/20/2025 (A0248203)	Battery	☒	☐	☐	☐	1	☐	☐	LTD 10/20 /2025
Main FACP In Tank Room, 10:51:25AM 10/20/2025 (A0248202)	Control Panel	☒	☐	☐	☐	1	☐	☒	LTD 10/20 /2025
Sprinkler Flow #1, 10:51:12AM 10/20/2025 (88536055)	Waterflow Switch	☒	☐	☒	☒	1-4	☐	☐	LTD 10/20 /2025
Sprinkler Flow #2, 10:50:46AM 10/20/2025 (88536056)	Waterflow Switch	☒	☐	☒	☒	1-6	☐	☐	LTD 10/20 /2025
Sprinkler Main Tamper, 10:50:26AM 10/20/2025 (88539409)	Supervisory Valve	☒	☐	☒	☒	1-8	☐	☐	LTD 10/20 /2025
Sprinkler Tamper #1, 10:50:42AM 10/20/2025 (88536051)	Supervisory Valve	☒	☐	☒	☒	1-5	☐	☐	LTD 10/20 /2025
Sprinkler Tamper #2, 10:50:35AM 10/20/2025 (88536049)	Supervisory Valve	☒	☐	☒	☒	1-7	☐	☐	LTD 10/20 /2025
Tank Room Above Pull Station, 10:49:38AM 10/20/2025 (A0248108)	End Of Line	☒	☐	☒	☒	1-2	☒	☒	LTD 10/20 /2025
Tank Room Main Entrance, 10:49:45AM 10/20/2025 (A0248107)	Pull Station	☒	☐	☒	☒	1-2	☐	☐	LTD 10/20 /2025
Tank Room Temperature Device, 10:53:38AM 10/20/2025 (A0248207)	Supervisory Device	☒	☐	☒	☒	1-11	☐	☐	LTD 10/20 /2025
Tank Room Above Tank (Barcode on Doorframe), 10:48:28AM 10/20/2025 (A0248109)	Smoke Detector	☒	☐	☒	☒	1-2	☐	☐	ST, LTD 10 /20/2025
Basement Room #1, 10:46:16AM 10/20/2025 (A0248204)	Horn/Strobe	☒	☐	☒	☐	1-NAC	☐	☐	LTD 10/20 /2025
Basement Room #2, 10:46:02AM 10/20/2025 (A0248121)	Horn/Strobe	☒	☐	☒	☐	1-NAC	☐	☐	LTD 10/20 /2025
Basement Room #2 East, 10:23:43AM 10/20/2025 (A0248097)	Heat Detector	☒	☐	☒	☒	1-1	☐	☐	LTD 10/20 /2025
Basement At Main Stair (Barcode on Doorframe), 10:35:21AM 10/20/2025 (A0245419)	Smoke Detector	☒	☐	☒	☒	1-1	☐	☐	LTD 10/20 /2025
Basement Furnace Room (Barcode on Doorframe), 10:33:50AM 10/20/2025 (A0248102)	Smoke Detector	☒	☐	☒	☒	1-1	☐	☐	ST, LTD 10 /20/2025
Basement Room #1 West- Living Room (Barcode on Doorframe), 10:46:44AM 10/20/2025 (A0248098)	Smoke Detector	☒	☐	☒	☒	1-1	☐	☐	ST, LTD 10 /20/2025

Location	Device Type	Correctly Installed	Requires Service, Repairs, Cleaning or Missing	Alarm Operation Confirmed	Annunciation Indication Confirmed	Zone Circuit Number or Address	Supervision of Wiring Device Confirmed	Ground Circuit Confirmed	Remarks/ Readings
Basement Room #1 West- Storage Room (Barcode on Doorframe), 10:32:04AM 10/20/2025 (A0248099)	Smoke Detector	☒	☐	☒	☒	1-1	☐	☐	ST, LTD 10 /20/2025
Basement Room #2 East- Activity Room (Barcode on Doorframe), 10:28:24AM 10/20/2025 (A0248101)	Smoke Detector	☒	☐	☒	☒	1-1	☐	☐	ST, LTD 10 /20/2025
Basement Room #1 West- Bed Room (Barcode on Doorframe), 10:56:35AM 10/20/2025 (A0248100)	Smoke Detector	☐	☒	☐	☐	1-1	☐	☐	ST, LTD 10 /20/2025

Inspection & Testing

Generated by: BuildingReports.ca

Building: Kerry's Place		Control Panel: 1 - Mircom FA-1000		
The Inspection & Testing section lists all of the items inspected in your building. Items are grouped by Passed or Failed/Other. Items are listed by Category. Each item includes the services performed, and the time & date at which testing occurred.				
Device Type	Location	Service	Time	Date
Passed				
Control				
Annunciator	East House Annunciator Main Entrance	Tested	10:21:11 AM	10/20/2025
Battery	Main FACP In Tank Room	Tested	10:52:33 AM	10/20/2025
Control Panel	Main FACP In Tank Room	Tested	10:51:25 AM	10/20/2025
Indicating				
Horn/Strobe	1st Floor At Hallway Ending East	Tested	10:36:27 AM	10/20/2025
Horn/Strobe	1st Floor Living Room	Tested	10:43:55 AM	10/20/2025
Horn/Strobe	Basement Room #1	Tested	10:46:16 AM	10/20/2025
Horn/Strobe	Basement Room #2	Tested	10:46:02 AM	10/20/2025
Initiating				
Heat Detector	1st Floor At Kitchen (Barcode on Doorframe)	Tested	10:43:23 AM	10/20/2025
Heat Detector	Basement Room #2 East	Tested	10:23:43 AM	10/20/2025
Pull Station	1st Floor Main Entrance	Tested	10:21:30 AM	10/20/2025
Pull Station	1st Floor Rear Entrance	Tested	10:42:00 AM	10/20/2025
Pull Station	Tank Room Main Entrance	Tested	10:49:45 AM	10/20/2025
Smoke Detector	1st Floor Hallway East (Barcode on Doorframe)	Tested/Cleaned	10:38:04 AM	10/20/2025
Smoke Detector	1st Floor Living Room (Barcode on Kitchen Doorframe)	Tested/Cleaned	10:44:37 AM	10/20/2025
Smoke Detector	1st Floor Office North (Barcode on Doorframe)	Tested/Cleaned	10:39:30 AM	10/20/2025
Smoke Detector	1st Floor Room #1 South/East (Barcode on Doorframe)	Tested/Cleaned	10:41:25 AM	10/20/2025
Smoke Detector	1st Floor Room #2 East (Barcode on Doorframe)	Tested/Cleaned	10:40:33 AM	10/20/2025
Smoke Detector	1st Floor Top of Main Stair	Tested/Cleaned	10:29:05 AM	10/20/2025
Smoke Detector	Tank Room Above Tank (Barcode on Doorframe)	Tested/Cleaned	10:48:28 AM	10/20/2025
Smoke Detector	Basement At Main Stair (Barcode on Doorframe)	Tested/Cleaned	10:35:21 AM	10/20/2025
Smoke Detector	Basement Furnace Room (Barcode on Doorframe)	Tested/Cleaned	10:33:50 AM	10/20/2025

Device Type	Location	Service	Time	Date
<i>Passed</i>				
Smoke Detector	Basement Room #1 West- Living Room (Barcode on Doorframe)	Tested/Cleaned	10:46:44 AM	10/20/2025
Smoke Detector	Basement Room #1 West- Storage Room (Barcode on Doorframe)	Tested/Cleaned	10:32:04 AM	10/20/2025
Smoke Detector	Basement Room #2 East- Activity Room (Barcode on Doorframe)	Tested/Cleaned	10:28:24 AM	10/20/2025
Waterflow Switch	Sprinkler Flow #1	Tested	10:51:12 AM	10/20/2025
Waterflow Switch	Sprinkler Flow #2	Tested	10:50:46 AM	10/20/2025
Supervisory				
End Of Line	1st Floor At Rear Exit	Tested	10:42:48 AM	10/20/2025
End Of Line	Tank Room Above Pull Station	Tested	10:49:38 AM	10/20/2025
Supervisory Device	Tank Room Temperature Device	Tested	10:53:38 AM	10/20/2025
Supervisory Valve	Sprinkler Main Tamper	Tested	10:50:26 AM	10/20/2025
Supervisory Valve	Sprinkler Tamper #1	Tested	10:50:42 AM	10/20/2025
Supervisory Valve	Sprinkler Tamper #2	Tested	10:50:35 AM	10/20/2025
Device Type	Location	Service	Time	Date
<i>Failed/Other</i>				
Initiating				
Smoke Detector	Basement Room #1 West- Bed Room (Barcode on Doorframe)	Tested/Cleaned	10:56:35 AM	10/20/2025

Sensitivity Testing

Generated by: BuildingReports.ca

Building: Kerry's Place			Control Panel: 1 - Mircom FA-1000		
The Sensitivity Testing section details the sensitivity test ranges and acceptable readings for each type of device. Items are grouped by Passed or Failed/Other. Normally, Devices that perform outside the acceptable range of sensitivity are listed in Failed/Other.					
Location	Address	Model #	Range	Value	ScanID
Passed					
Smoke Detector					
1st Floor Hallway East (Barcode on Doorframe)	1-1	C2W-BA	1.0 - 4.0	ST	A0245421
1st Floor Living Room (Barcode on Kitchen Doorframe)	1-1	C2W-BA	1.0 - 4.0	ST	A0245425
1st Floor Office North (Barcode on Doorframe)	1-1	C2W-BA	1.0 - 4.0	ST	A0248093
1st Floor Room #1 South/East (Barcode on Doorframe)	1-1	C2W-BA	1.0 - 4.0	ST	A0245422
1st Floor Room #2 East (Barcode on Doorframe)	1-1	C2W-BA	1.0 - 4.0	ST	A0248092
1st Floor Top of Main Stair	1-1	C2W-BA	1.0 - 4.0	ST	A0248122
Tank Room Above Tank (Barcode on Doorframe)	1-2	C2W-BA	1.0 - 4.0	ST	A0248109
Basement At Main Stair (Barcode on Doorframe)	1-1	C2W-BA	1.0 - 4.0		A0245419
Basement Furnace Room (Barcode on Doorframe)	1-1	C2W-BA	1.0 - 4.0	ST	A0248102
Basement Room #1 West- Living Room (Barcode on Doorframe)	1-1	C2W-BA	1.0 - 4.0	ST	A0248098
Basement Room #1 West- Storage Room (Barcode on Doorframe)	1-1	C2W-BA	1.0 - 4.0	ST	A0248099
Basement Room #2 East- Activity Room (Barcode on Doorframe)	1-1	C2W-BA	1.0 - 4.0	ST	A0248101
Device Total: 12					
Failed/Other					
Smoke Detector					
Basement Room #1 West- Bed Room (Barcode on Doorframe)	1-1	C2W-BA	1.0 - 4.0	ST	A0248100
Device Total: 1					

Inventory & Warranty Report

Generated by: BuildingReports.ca

Building: Kerry's Place			Control Panel: 1 - Mircom FA-1000		
<i>The Inventory & Warranty Report lists each of the devices and items that are included in your Inspection Report. A complete inventory count by device type and category is provided. Items installed within the last 90 days, within the last year, and devices installed for two years or more are grouped together for easy reference.</i>					
Device or Type		Category		% of Inventory	Quantity
Annunciator		Control		3.03%	1
Battery		Control		3.03%	1
Control Panel		Control		3.03%	1
End Of Line		Supervisory		6.06%	2
Heat Detector		Initiating		6.06%	2
Horn/Strobe		Indicating		12.12%	4
Pull Station		Initiating		9.09%	3
Smoke Detector		Initiating		39.39%	13
Supervisory Device		Supervisory		3.03%	1
Supervisory Valve		Supervisory		9.09%	3
Waterflow Switch		Initiating		6.06%	2
Type	Qty	Model #	Description		Install Date
In Service - 90 Days - 1 Year					
CanArm					
Supervisory Device	1				10/28/2024
Global					
Supervisory Valve	3	Butterfly Valve			10/28/2024
Magnavolt					
Battery	1	x2 12v 12 ah	Sealed Lead Acid	10/28/2024	
Mircom					
Annunciator	1	RA-1000	LED List	10/28/2024	
Control Panel	1	FA-1000	Conventional	10/28/2024	
End Of Line	1	MP-300		10/28/2024	
Horn/Strobe	4			10/28/2024	
Pull Station	3	MS-401	Single Action	10/28/2024	
System Sensor					
End Of Line	1	Mircom 3.9K		10/28/2024	
Heat Detector	2	5601A	Rate-of-Rise	10/28/2024	
Smoke Detector	13	C2W-BA	Photoelectric	10/28/2024	
Waterflow Switch	2	WFDTA		10/28/2024	

Safety Equipment Inspection Report

For


Kerry's Place

Building Number: 1543575

This Inspection was performed in accordance with applicable standards. The subsequent pages of this report provide performance measurements, listed ranges of acceptable results, and complete documentation of the inspection. Whenever discrepancies exist between acceptable performance standards and actual test results, notes and/or recommended solutions have been proposed or provided for immediate review and approval.

The devices in this report are 100% tested and 90% passed

*Annual Inspection
Inspection Date
Oct 20, 2025*



Building: Kerry's Place
Contact: MAIN .



Company: Georgian Bay Fire & Safety - Peterborough
Contact: Derek Rennie
Safety Equipment Report

Executive Summary

Generated by: BuildingReports.ca

Building Information

Building: Kerry's Place

Contact: MAIN .

Address:

Phone: .

Address:

City/Province/Postal Code:

Email: accountspayable@kerrysplace.org

Inspection Performed By

Company: Georgian Bay Fire & Safety - Peterborough

Inspector: Derek Rennie

Address: 347 Pido Road

Phone: 1-800-265-3197

Address: Unit 19

City/Province/Postal Code: Peterborough, Ontario K9J 6X7

Email: derek.rennie@fire-sp.com

Inspection Summary

Category:	Total Items		Serviced		Passed		Failed/Other	
	Qty	%	Qty	%	Qty	%	Qty	%
Fire	6	60.00%	6	100.00%	6	100.00%	0	0.00%
Lighting	4	40.00%	4	100.00%	3	75.00%	1	25.00%
Totals	10	100%	10	100.00%	9	90.00%	1	10.00%

Certification

Company: Georgian Bay Fire & Safety - Peterborough


Building: Kerry's Place

Inspector: Derek Rennie

Contact: MAIN .



Signed: Oct 20, 2025

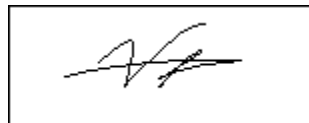

Signed: Oct 20, 2025

Discrepancy Report with Proposed Solutions

Generated by: BuildingReports.ca

Building: Kerry's Place								
<i>This report consolidates all discrepancies and provides proposed solutions to these issues. Discrepancies are listed by Category, and grouped by device type. The description of the problem is provided and where appropriate, code references are listed for your convenience. Any devices that have been corrected and passed the retest are checkmarked under the Fixed column and details regarding the individual who completed the fix are noted in the last column. Any item that was inspected that is subject to a recall or part of a manufacturer's replacement/upgrade program is included.</i>								
Device Type	Manufacturer	Model Number	Date	Qty				
Items listed for Recall or Replacement/Upgrade								
No items found during this inspection.								
Scan Number	Model	Type/Size	Discrepancy	Solution	Cost	A P P R O V E D	F I X E D	Date Corrected and Passed Retest
Emergency Light, Power Unit								
A0245454	RG 36	Power Unit	Failed Test NFPA101 7.9.2.1	Req. x1 6V7AH	T/M	☐	☐	
Location: East House In Hallway			Note:					

Total Cost (excluding taxes): T/M

Customer WO/PO #: (none)

Internal WO/PO #: (none)

Inspection & Testing

Generated by: BuildingReports.ca

Building: Kerry's Place				
<i>The Inspection & Testing section lists all of the items inspected in your building. Items are grouped by Passed or Failed /Other. Items are listed by Category. Each item includes the services performed, and the time & date at which testing occurred.</i>				
Device Type	Location	ScanID : S/N	Service	Date Time
Passed				
Fire				
Fire Extinguisher, 5 Lbs, A.B.C.	East House At Dining room exit	A0248113 H29013824	Inspected	10/20/25 12:13:27 PM
Fire Extinguisher, 10 Lbs, A.B.C.	East House At Entrance	A0248110 1658	Inspected	10/20/25 12:16:24 PM
Fire Extinguisher, 10 Lbs, A.B.C.	East House Basement in Furnace Room	A0248116 B-04539969	Inspected	10/20/25 12:11:01 PM
Fire Extinguisher, 10 Lbs, A.B.C.	East House Basement in Water Tank Room	A0248119 AF456580	Inspected	10/20/25 12:05:50 PM
Fire Extinguisher, 10 Lbs, A.B.C.	East House Basement in Water Tank Room	A0248117 YN50143	Inspected	10/20/25 12:07:21 PM
Fire Extinguisher, 5 Lbs, A.B.C.	East House In Kitchen	A0248115 H29013823	Inspected	10/20/25 12:15:10 PM
Lighting				
Emergency Light, Combination	East House Above Main Entrance	A0245456	Inspected	10/20/25 12:12:47 PM
Emergency Light, Power Unit	East House At Dining room exit	A0245455	Inspected	10/20/25 12:14:48 PM
Emergency Light, Combination	East House Basement in Room 1	A0248120	Inspected	10/20/25 12:04:26 PM
Failed/Other				
Lighting				
Emergency Light, Power Unit	East House In Hallway	A0245454	Inspected	10/20/25 1:17:41 PM

Fire Extinguisher Maintenance Report

Generated by: BuildingReports.ca

Building: Kerry's Place					
<i>This report provides details on the Hydrostatic Test and Maintenance/Breakdown dates for fire extinguishers. Items that will need either of these services at any time in the next two years are displayed. Items are grouped together by year for budgeting purposes.</i>					
ScanID	Location	Serial #	Hydro	Breakdown	Mfr Date
Due in 2026					
Breakdown/Maintenance					
Fire Extinguisher, A.B.C., 10 Lbs					
A0248117	East House Basement in Water Tank Room	YN50143	10/28/20	10/28/20	10/28/07
Total Fire Extinguisher, A.B.C., 10 Lbs:					1

Exit/Emergency Lighting

Generated by: BuildingReports.ca

Building: Kerry's Place								
Exit and Emergency Lighting items are listed with each of the relevant measurements for pre and post test voltages, the load current, charge rate, and the rated voltage and current capacity of standby batteries. The remote heads indicate the number of other items that get their supply voltage from this item. Items are listed by type, and grouped by Passed or Failed /Other.								
Location	Model #	Rated Volts	Pre-Test Volts	Post-Test Volts	Load Amps	Charge Amps	Remote Heads	Amp Hours
Passed								
Emergency Light, Combination								
East House Basement in Room 1		6						7
East House Above Main Entrance		6						7
Emergency Light, Power Unit								
East House At Dining room exit	RG 36	6					2	7
Failed/Other								
Emergency Light, Power Unit								
East House In Hallway	RG 36	6					2	7