

Sprinkler Inspection Report

For

Kerry's Place

Building Number: 1544808

This Inspection was performed in accordance with NFPA 25 - 2008 Edition. The subsequent pages of this report provide performance measurements, listed ranges of acceptable results, and complete documentation of the inspection. Whenever discrepancies exist between acceptable performance standards and actual test results, notes and/or recommended solutions have been proposed or provided for immediate review and approval.

The devices in this report are 80% tested and 100% passed

☐ *The system is fully functional with no deficiencies at this time.*

☒ *The system has deficiencies which are noted in the discrepancy report.*

Annual Inspection

Inspection Date

Jan 13, 2026

Building: Kerry's Place

Contact: Ruby .

Company: Georgian Bay Fire & Safety - Markham

Contact: Justin Robinson

To obtain further details about this inspection please utilize your login and password to view online. This SprinklerScan report should be accompanied with the associated BRForm.

Sprinkler Inspection Report

Executive Summary

Generated by: BuildingReports.ca

Building Information								
Building: Kerry's Place			Contact: Ruby .					
Address:			Phone: .					
Address:			City/Province/Postal Code:					
Email: accountspayable@kerrysplace.org								
Inspection Performed By								
Company: Georgian Bay Fire & Safety - Markham				Inspector: Justin Robinson				
Address: 245 Riviera Dr				Phone: .				
Address: Unit 2				City/Province/Postal Code: Markham, Ontario L3R 5J9				
Email: justin.robinson@fire-sp.com								
System Control Unit								
System Type	System Location			Protected Area			Devices	
Wet Pipe	Basement			Back flow outlet			1	
Wet Pipe	Basement			Backflow inlet			1	
Wet Pipe	Basement			Building-			2	
Wet Pipe	Basement			FDC			1	
Inspection Summary								
Category:	Total Items		Serviced		Passed		Failed/Other	
	Qty	%	Qty	%	Qty	%	Qty	%
Alarm	1	20.00%	1	100.00%	1	100.00%	0	0.00%
Hose	1	20.00%	1	100.00%	0	0.00%	1	100.00%
Valve	3	60.00%	2	66.67%	2	100.00%	0	0.00%
Totals	5	100%	4	80.00%	3	75.00%	1	25.00%
Certification								
Company: Georgian Bay Fire & Safety - Markham				Building: Kerry's Place				
Inspector: Justin Robinson				Contact: Ruby .				

Discrepancy Report with Proposed Solutions

Generated by: BuildingReports.ca

Building: Kerry's Place								
<i>This report consolidates all discrepancies and provides proposed solutions to these issues. Discrepancies are listed by Category, and grouped by device type. The description of the problem is provided and where appropriate, code references are listed for your convenience. Any devices that have been corrected and passed the retest are checkmarked under the Fixed column and details regarding the individual who completed the fix are noted in the last column. Any item that was inspected that is subject to a recall or part of a manufacturer's replacement/upgrade program is included.</i>								
Device Type	Manufacturer	Model Number	Date	Qty				
Items listed for Recall or Replacement/Upgrade								
No items found during this inspection.								
Scan Number	Model	Type/Size	Discrepancy	Solution	Cost	A P P R O V E D	F I X E D	Date Corrected and Passed Retest
Fire Dep't Connection								
A0260466			Needs Hydro Test NFPA25 4.1.4	Hydro Test	T/M	☐	☒	02/09/26 Justin Robinson

Location: Basement

Note: -No record of 5 year hydrostatic test, this is now due - ball drip installed incorrectly Parts needed: -3/4" nipple, 3" long x 1 (galvanized) - 3/4" 90 (galvanized)

Total Cost (excluding taxes): T/M

Customer WO/PO #: (none)

Internal WO/PO #: (none)

Notes & Recommendations

Generated by: BuildingReports.ca

Building: Kerry's Place				
<i>The Notes & Recommendations Report details notes made by the technician during the course of the building inspection for passed devices and the inspection as a whole.</i>				
Note	Device Type	Location	Comment	ScanID
Basement Wet Pipe, Building-				
1	Backflow Prevention	Basement		A0220167
	Backflow was inspected and passed by Spira Fire			
2	Waterflow Switch	Basement	Passed	88536206
	Running a flow through 50' of garden hose will not give an accurate residual.			

Inspection & Testing

Generated by: BuildingReports.ca

Building: Kerry's Place				
<i>The Inspection & Testing section lists all of the items inspected in your building. Items are grouped by Passed or Failed/Other. Items are listed by Category. Each item includes the services performed, and the time & date at which testing occurred.</i>				
Device Type	Location	Service	Time	Date
<i>Passed</i>				
Basement Wet Pipe, Back flow outlet				
Control Valve	Basement	Annual	9:46:41 AM	01/13/2026
Basement Wet Pipe, Backflow inlet				
Control Valve	Basement	Annual	9:46:19 AM	01/13/2026
Basement Wet Pipe, Building-				
Waterflow Switch	Basement	Annual	9:43:12 AM	01/13/2026
<i>Failed/Other</i>				
Basement Wet Pipe, FDC				
2 Fire Dep't Connection	Basement	Annual	9:56:36 AM	01/13/2026
<i>Untested</i>				
Basement Wet Pipe, Building-				
Backflow Prevention	Basement			

Wet Pipe Fire Sprinkler Systems

Generated by: BuildingReports.ca

Building: Kerry's Place	Basement, Back flow outlet
-------------------------	----------------------------

This section lists out all the devices and components that have been associated with a Wet Pipe System and provides details as to type of component, pressure readings, response time, etc. If a component has an OK checkbox that is checked, then that component was tested and passed; however, if the OK checkbox is unchecked, refer to the Inspection & Testing section for test status.

Components

Control Valve

Type	Location	Manufacturer	Model #	OK	ScanID
	Basement	Potter	RBVS	☒	A0260468
Position	Size	Status	Description		

Building: Kerry's Place	Basement, Backflow inlet
-------------------------	--------------------------

This section lists out all the devices and components that have been associated with a Wet Pipe System and provides details as to type of component, pressure readings, response time, etc. If a component has an OK checkbox that is checked, then that component was tested and passed; however, if the OK checkbox is unchecked, refer to the Inspection & Testing section for test status.

Control Valve

Type	Location	Manufacturer	Model #	OK	ScanID
	Basement	Potter	RBVS	☒	A0260467
Position	Size	Status	Description		

Building: Kerry's Place	Basement, Building-
-------------------------	---------------------

This section lists out all the devices and components that have been associated with a Wet Pipe System and provides details as to type of component, pressure readings, response time, etc. If a component has an OK checkbox that is checked, then that component was tested and passed; however, if the OK checkbox is unchecked, refer to the Inspection & Testing section for test status.

Alarms

Waterflow Switch

Type	Manufacturer	Model #	Sec	Size	Zone/Address	OK	ScanID
		VSR-M			1	☒	88536206

Components

Backflow Prevention

Manufacturer	Model #	Size	Type	Service Type	Install Date	OK	ScanID
Wilkins zurn.	350 XLDC	1.25"	Double Check	Fire Line Isolation	12/05/2023	☐	A0220167
Water Purveyor		Location	5-Year	Meter Acct. #	Serial #		

Basement				12/31/1969				
Initial Test								
Check Valve 1	Check Valve 2	Relief Valve	Pressure Vacuum Breaker	Held At (psid)				
Repairs or Notes								
Backflow was inspected and passed by Spira Fire								
Final Test								
Check Valve 1	Check Valve 2	Relief Valve	Pressure Vacuum Breaker	Held At (psid)				
Condition of Control Valve 1		Condition of Control Valve 2						
Building: Kerry's Place								
Basement, FDC								
<i>This section lists out all the devices and components that have been associated with a Wet Pipe System and provides details as to type of component, pressure readings, response time, etc. If a component has an OK checkbox that is checked, then that component was tested and passed; however, if the OK checkbox is unchecked, refer to the Inspection & Testing section for test status.</i>								
Devices								
Fire Dep't Connection								
Location	Type	Size	Qty	BallDrip	Rotating Swivels	5-Year Hydro	OK	ScanID
Basement						01/13/2026	☐	A0260466

Safety Equipment Inspection Certificate

For

Kerry's Place

Building Number: 1544808

Any extinguisher inspections completed in accordance to Ontario Regulation 213/07,
OFC 6.2.7.1

Any emergency light inspections completed in accordance to Ontario Regulation 213/07,
OFC 2.7.3.3


This Inspection was performed in accordance with applicable standards. The subsequent pages of this report provide performance measurements, listed ranges of acceptable results, and complete documentation of the inspection. Whenever discrepancies exist between acceptable performance standards and actual test results, notes and/or recommended solutions have been proposed or provided for immediate review and approval.

The devices in this report are 100% tested and 100% passed

Annual Inspection

Inspection Date

Jan 13, 2026

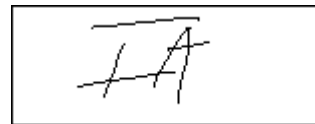

Building: Kerry's Place Contact: Ruby .

Company: Georgian Bay Fire & Safety - Markham
Contact: Ishtiaq Azam

To obtain further details about this inspection please utilize your login and password to view online.

Safety Equipment Report

Executive Summary

Generated by: BuildingReports.ca

Building Information

Building: Kerry's Place

Contact: Ruby .

Address:

Phone: .

Address:

City/Province/Postal Code:

Email: accountspayable@kerrysplace.org

Inspection Performed By

Company: Georgian Bay Fire & Safety - Markham

Inspector: Ishtiaq Azam

Address: 245 Riviera Dr

Phone: 519-377-2668

Address: Unit 2

City/Province/Postal Code: Markham, Ontario L3R 5J9

Email: iazam@gbfire.com

Inspection Summary

Category:	Total Items		Serviced		Passed		Failed/Other	
	Qty	%	Qty	%	Qty	%	Qty	%
Fire	5	50.00%	5	100.00%	5	100.00%	0	0.00%
Lighting	5	50.00%	5	100.00%	5	100.00%	0	0.00%
Totals	10	100%	10	100.00%	10	100.00%	0	0.00%


Certification

Company: Georgian Bay Fire & Safety - Markham

Building: Kerry's Place

Inspector: Ishtiaq Azam

Contact: Ruby .

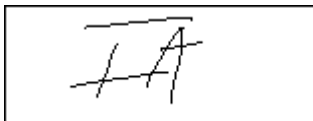

Signed: Jan 13, 2026

Signed:

Notes & Recommendations

Generated by: BuildingReports.ca

Building: Kerry's Place

The Notes & Recommendations Report details notes made by the technician during the course of the building inspection for passed devices and the inspection as a whole.

Note	Device Type	Location	Comment	ScanID
Lighting				
1	Emergency Light - Hardwired unit.	Basement Outside Bathroom	Passed	A4648646
2	Emergency Light - Hardwired unit.	Basement Above Emergency Exit	Passed	A4648647
3	Emergency Light - Hardwired unit.	1st Inside Kitchen	Passed	A4648643
4	Exit Sign - Hardwired unit.	1st Above Main Entrance	Passed	A4648641
5	Emergency Light - Hardwired unit.	2nd Outside Rooms	Passed	A4648639

Inspection & Testing

Generated by: BuildingReports.ca

Building: Kerry's Place				
<i>The Inspection & Testing section lists all of the items inspected in your building. Items are grouped by Passed or Failed /Other. Items are listed by Category. Each item includes the services performed, and the time & date at which testing occurred.</i>				
Device Type	Location	ScanID : S/N	Service	Date Time
Passed				
Fire				
Fire Extinguisher, 5 Lbs, A.B.C.	Basement Inside Larger Living Room	A4648645 F90185004	Inspected	01/13/26 3:13:48 PM
Fire Extinguisher, 5 Lbs, A.B.C.	1st At Main Entrance	A4648640 G22846422	Inspected	01/13/26 2:55:55 PM
Fire Extinguisher, 5 Lbs, A.B.C.	1st Inside Kitchen	A4648642 F90190990	Inspected	01/13/26 4:07:04 PM
Fire Extinguisher, 5 Lbs, A.B.C.	2nd At Stairwell	A4648638 C93117608	Inspected	01/13/26 2:42:53 PM
Fire Extinguisher, 5 Lbs, A.B.C.	Garage	A4648644 F90190958	Inspected	01/13/26 3:06:52 PM
Lighting				
Emergency Light, Combination	Basement Above Emergency Exit	A4648647	Inspected	01/13/26 3:18:53 PM
Emergency Light, Combination	Basement Outside Bathroom	A4648646	Inspected	01/13/26 3:17:31 PM
Emergency Light, Combination	1st Inside Kitchen	A4648643	Inspected	01/13/26 3:03:22 PM
Emergency Light, Combination	2nd Outside Rooms	A4648639	Inspected	01/13/26 2:49:12 PM
Exit Sign, LED	1st Above Main Entrance	A4648641	Inspected	01/13/26 2:55:14 PM

Fire Extinguisher Maintenance Report

Generated by: BuildingReports.ca

Building: Kerry's Place					
<i>This report provides details on the Hydrostatic Test and Maintenance/Breakdown dates for fire extinguishers. Items that will need either of these services at any time in the next two years are displayed. Items are grouped together by year for budgeting purposes.</i>					
ScanID	Location	Serial #	Hydro	Breakdown	Mfr Date
Due in 2027					
Breakdown/Maintenance					
Fire Extinguisher, A.B.C., 5 Lbs					
A4648644	Garage	F90190958	01/13/21	01/13/21	01/13/21
A4648645	Basement Inside Larger Living Room	F90185004	03/06/21	03/06/21	03/06/21
A4648642	1st Inside Kitchen	F90190990	03/06/21	03/06/21	03/06/21
Total Fire Extinguisher, A.B.C., 5 Lbs:					3

Exit/Emergency Lighting

Generated by: BuildingReports.ca

Building: Kerry's Place								
<i>Exit and Emergency Lighting items are listed with each of the relevant measurements for pre and post test voltages, the load current, charge rate, and the rated voltage and current capacity of standby batteries. The remote heads indicate the number of other items that get their supply voltage from this item. Items are listed by type, and grouped by Passed or Failed /Other.</i>								
Location	Model #	Rated Volts	Pre-Test Volts	Post-Test Volts	Load Amps	Charge Amps	Remote Heads	Amp Hours
Passed								
Emergency Light, Combination								
Basement Outside Bathroom	JRMECW	3.6						1.8
Basement Above Emergency Exit	JRMECW	3.6						1.8
1st Inside Kitchen	JRMECW	3.6						1.8
2nd Outside Rooms		3.6						1.8
Exit Sign, LED								
1st Above Main Entrance	CM-SS-SP	3.6						1

Fire Alarm and Life Safety System Inspection Certificate

For

Kerry's Place

Building Number: 1544808

Tested to CAN/ULC S536-04 Standard

Smoke alarms are inspected to CAN ULC S553-02

This report should be accompanied by the BRForm containing the contents of CAN/ULC S536-04 Appendix E


This Inspection was performed in accordance with applicable ULC Standards. The subsequent pages of this report provide performance measurements, listed ranges of acceptable results, and complete documentation of the inspection. Whenever discrepancies exist between acceptable performance standards and actual test results, notes and/or recommended solutions have been proposed or provided for immediate review and approval.

The devices in this report are 100% tested and 100% passed

Start Date: Jan 13, 2026

End Date: Feb 24, 2026

Service - Visually Checked

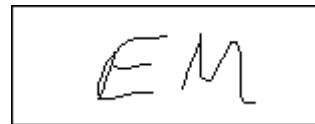

Building: Kerry's Place Contact: Ruby .

Company: Georgian Bay Fire & Safety - Markham
Contact: Emad Mazraie

To obtain further details about this inspection please utilize your login and password to view online.
This FireScan report should be accompanied with the associated BRForm.

Fire Alarm Testing Report

Executive Summary

Generated by: BuildingReports.ca

Building Information		
Building: Kerry's Place	Contact: Ruby .	
Address:	Phone: .	
Address:	City/Province/Postal Code:	
Email: accountspayable@kerrysplace.org		
Inspection Performed By		
Company: Georgian Bay Fire & Safety - Markham	Inspector: Emad Mazraie	
Address: 245 Riviera Dr	Phone: (416) 902-1083	
Address: Unit 2	City/Province/Postal Code: Markham, Ontario L3R 5J9	
Email: emazraie@gbfire.com		
System Control Unit		
Manufacturer: Mircom	Inspection Date: 01/13/2026	IDC Style:
Model Number: FA-1000	Install Date: 01/01/2021	SLC Style:
Software Version: 1.0.18	Version Date: 01/01/2021	NAC Style:
Location: 1st At Main Entrance	Current Protection:	Auto Evac Time:
Central Station Signal Verification		
Type:	Mfg:	Model #:
Test Time/Date:	Restore Time:	
Type of Signal	Signal Confirmation	Notes
Type: Alarm/Trouble/Supervisory	Confirmed Time:	
Certification		
Company: Georgian Bay Fire & Safety - Markham	Building: Kerry's Place	
Inspector: Emad Mazraie	Contact: Ruby .	
		
Signed: Jan 13, 2026	Signed:	

Notes & Recommendations

Generated by: BuildingReports.ca

Building: Kerry's Place			Control Panel: 1 - Mircom FA-1000	
<i>The Notes & Recommendations Report details notes made by the technician during the course of the building inspection for passed devices and the inspection as a whole.</i>				
Note	Device Type	Location	Comment	ScanID
Initiating				
1	Pull Station	Basement Beside Emergency Exit	Passed	A4648625
	Label inside of device.			
2	Duct Detector	Basement Inside AHU Room Duct #2	Passed	91076754
	EOL inside device.			
3	Duct Detector	Basement Inside AHU Room Duct #3	Passed	91076756
	EOL inside device.			
4	Duct Detector	Basement Inside AHU Room Duct #4	Passed	91076930
	EOL inside device, hard to reach.			
5	Duct Detector	Basement Inside AHU Room Duct #5	Passed	91076758
	EOL inside device.			
6	Pull Station	Basement Inside Larger Living Room	Passed	91076928
	Label inside of device.			
7	Smoke Alarm	Basement Inside Larger Living Room	Passed	A4648615
	Interconnected.			
8	Smoke Alarm	Basement Inside Larger Living Room	Passed	A4648623
	Standalone.			
9	Smoke Alarm	Basement Inside Smaller Living Room Outside Bathroom	Passed	A4648627
	Interconnected.			
10	Pull Station	Basement Outside Bathroom	Passed	A4648626
	Label inside of device.			
11	Pull Station	1st At Main Entrance	Passed	A4648592
	Label inside device.			
12	Smoke Alarm	1st Beside Stairwell	Passed	A4648599
	Interconnected.			
13	Smoke Alarm	1st Inside Fireplace Room	Passed	A4648603
	Interconnected.			
14	Pull Station	1st Inside Kitchen	Passed	A4648596
	Label inside device.			
15	Pull Station	1st Inside Laundry Room	Passed	A4648597
	Label inside of device.			
16	Smoke Alarm	2nd Inside East End Vestibule	Passed	A4648587
	Interconnected.			
Supervisory				

Note	Device Type	Location	Comment	ScanID
17	End Of Line	Basement Above Ceiling Larger Living Room Duct #6	Passed	A4648624
	EOL for duct smoke #6.			
18	End Of Line	Basement Inside AHU Room	Passed	91076753
	EOL for smoke detector inside mechanical room.			
19	End Of Line	Basement Inside AHU Room	Passed	91076755
	EOL for duct smoke #1			
20	End Of Line	2nd Beside Stairwell	Passed	A4648589
	Replaced on site during annual inspection as existing one had stripped screw holes causing open to stay on panel.			

Individual Device Record

Generated by: BuildingReports.ca

Type of Inspection: Fire Alarm System Annual Inspection and Test (ULC S536-04)

Building Name: Kerry's Place

Inspection Date and Time: 2/24/26 8:37:39 PM

Inspector: Emad Mazraie

Note: The Location Column includes the location, time and date of the inspection and barcode number.

Remarks Column: Detector sensitivity in percentage and Waterflow Switch time delay in seconds.

For specific output circuit operation confirmation see associated BRForm section - "Ancillary Function Testing"

Location	Device Type	Correctly Installed	Requires Service, Repairs, Cleaning or Missing	Alarm Operation Confirmed	Annunciation Indication Confirmed	Zone Circuit Number or Address	Supervision of Wiring Device Confirmed	Ground Circuit Confirmed	Remarks/ Readings
Tested									
Basement Above Emergency Exit, 1:33:38PM 01/13/2026 (91076763)	Smoke Detector	☒	☐	☒	☒	1-6 N/A	☐	☐	2.3, LTD 01/13/2026
Basement Above Ceiling Larger Living Room Duct #6, 1:25:27PM 01/13/2026 (91076929)	Duct Detector	☒	☐	☒	☒	1-14 N/A	☐	☐	LTD 01/13/2026
Basement Above Ceiling Larger Living Room Duct #6, 1:26:10PM 01/13/2026 (A4648624)	End Of Line	☒	☐	☒	☒	1-14 N/A	☒	☒	LTD 01/13/2026
Basement Beside Emergency Exit, 1:33:45PM 01/13/2026 (91076760)	End Of Line	☒	☐	☒	☒	1-6 N/A	☒	☒	LTD 01/13/2026
Basement Beside Emergency Exit, 1:32:12PM 01/13/2026 (A4648625)	Pull Station	☒	☐	☒	☒	1-1 N/A	☐	☐	LTD 01/13/2026
Basement Inside AHU Room, 1:50:47PM 01/13/2026 (91076755)	End Of Line	☒	☐	☒	☒	1-9 N/A	☒	☒	LTD 01/13/2026
Basement Inside AHU Room, 1:44:51PM 01/13/2026 (91076753)	End Of Line	☒	☐	☒	☒	1-7 N/A	☒	☒	LTD 01/13/2026
Basement Inside AHU Room, 1:44:56PM 01/13/2026 (91076752)	Smoke Detector	☒	☐	☒	☒	1-7 N/A	☐	☐	2.3, LTD 01/13/2026
Basement Inside AHU Room Duct #1, 1:50:31PM 01/13/2026 (91076757)	Duct Detector	☒	☐	☒	☒	1-9 N/A	☐	☐	LTD 01/13/2026
Basement Inside AHU Room Duct #2, 1:45:57PM 01/13/2026 (91076754)	Duct Detector	☒	☐	☒	☒	1-10 N/A	☐	☐	LTD 01/13/2026

Location	Device Type	Correctly Installed	Requires Service, Repairs, Cleaning or Missing	Alarm Operation Confirmed	Annunciation Indication Confirmed	Zone Circuit Number or Address	Supervision of Wiring Device Confirmed	Ground Circuit Confirmed	Remarks/ Readings
Basement Inside AHU Room Duct #3, 1:48:24PM 01/13/2026 (91076756)	Duct Detector	☒	☐	☒	☒	1-11 N/A	☐	☐	LTD 01/13 /2026
Basement Inside AHU Room Duct #4, 1:56:50PM 01/13/2026 (91076930)	Duct Detector	☒	☐	☒	☒	1-12 N/A	☐	☐	LTD 01/13 /2026
Basement Inside AHU Room Duct #5, 1:54:55PM 01/13/2026 (91076758)	Duct Detector	☒	☐	☒	☒	1-13 N/A	☐	☐	LTD 01/13 /2026
Basement Inside Bedroom Closet, 1:37:19PM 01/13/2026 (91076764)	Smoke Detector	☒	☐	☒	☒	1-1 N/A	☐	☐	2.3, LTD 01 /13/2026
Basement Inside Larger Living Room, 1:18:22PM 01/13/2026 (A4648623)	Smoke Alarm	☒	☐	☐	☐	1-N/A N/A	☐	☐	LTD 01/13 /2026
Basement Inside Larger Living Room, 1:08:59PM 01/13/2026 (91076928)	Pull Station	☒	☐	☒	☒	1-1 N/A	☐	☐	LTD 01/13 /2026
Basement Inside Larger Living Room, 2:08:08PM 01/13/2026 (A4648616)	Smoke Detector	☒	☐	☒	☒	1-1 N/A	☐	☐	2.3, LTD 01 /13/2026
Basement Inside Larger Living Room, 2:08:35PM 01/13/2026 (A4648617)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
Basement Inside Larger Living Room, 2:07:47PM 01/13/2026 (A4648615)	Smoke Alarm	☒	☐	☐	☐	1-N/A	☐	☐	LTD 01/13 /2026
Basement Inside Larger Living Room Inside Bedroom, 2:07:18PM 01/13/2026 (A4648614)	Smoke Detector	☒	☐	☒	☒	1-1 N/A	☐	☐	2.3, LTD 01 /13/2026
Basement Inside Larger Living Room Inside Bedroom, 2:06:18PM 01/13/2026 (A4648613)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
Basement Inside Smaller Living Room, 2:10:10PM 01/13/2026 (A4648620)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
Basement Inside Smaller Living Room Above Kitchen, 2:12:57PM 01/13/2026 (A4648628)	Smoke Detector	☒	☐	☒	☒	1-1 N/A	☐	☐	2.3, LTD 01 /13/2026
Basement Inside Smaller Living Room Inside Bedroom, 2:09:00PM 01/13/2026 (A4648618)	Smoke Detector	☒	☐	☒	☒	1-1 N/A	☐	☐	2.3, LTD 01 /13/2026
Basement Inside Smaller Living Room Inside Bedroom, 2:09:34PM 01/13/2026 (A4648619)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
Basement Inside Smaller Living Room Outside Bathroom, 2:12:11PM 01/13/2026 (A4648627)	Smoke Alarm	☒	☐	☐	☐	1-N/A	☐	☐	LTD 01/13 /2026
Basement Inside Sprinkler Room, 2:13:25PM 01/13/2026 (A4648629)	Smoke Detector	☒	☐	☒	☒	1-1 N/A	☐	☐	2.3, LTD 01 /13/2026
Basement Inside Stairwell, 2:03:54PM 01/13/2026 (91076869)	End Of Line	☒	☐	☒	☒	1-5 N/A	☒	☒	LTD 01/13 /2026
Basement Inside Stairwell, 2:05:54PM 01/13/2026 (A4648612)	Smoke Detector	☒	☐	☒	☒	1-5 N/A	☐	☐	2.3, LTD 01 /13/2026
Basement Outside Bathroom, 1:35:09PM 01/13/2026 (A4648626)	Pull Station	☒	☐	☒	☒	1-1 N/A	☐	☐	LTD 01/13 /2026

Location	Device Type	Correctly Installed	Requires Service, Repairs, Cleaning or Missing	Alarm Operation Confirmed	Annunciation Indication Confirmed	Zone Circuit Number or Address	Supervision of Wiring Device Confirmed	Ground Circuit Confirmed	Remarks/ Readings
1st At FACP, 11:30:31AM 02/18/2026 (A4648661)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/18 /2026
1st At FACP, 11:32:01AM 02/18/2026 (A4648662)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/18 /2026
1st At FACP, 11:32:54AM 02/18/2026 (A4648656)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/18 /2026
1st At FACP, 11:34:42AM 02/18/2026 (A4648660)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/18 /2026
1st At FACP, 8:37:25PM 02/24/2026 (A4648657)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/24 /2026
1st At FACP, 8:37:34PM 02/24/2026 (A4648663)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/24 /2026
1st At FACP, 8:37:39PM 02/24/2026 (A4648665)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/24 /2026
1st At Main Entrance, 3:50:10PM 01/13/2026 (A4648622)	Control Panel	☒	☐	☐	☐	1-N/A N/A	☐	☒	LTD 01/13 /2026
1st At Main Entrance, 11:26:50AM 01/13/2026 (A4648592)	Pull Station	☒	☐	☒	☒	1-2 N/A	☐	☐	LTD 01/13 /2026
1st At Main Entrance Left One, 11:30:53AM 01/13/2026 (A4648593)	Module	☒	☐	☒	☒	1	☐	☐	LTD 01/13 /2026
1st At Main Entrance Middle One, 11:31:22AM 01/13/2026 (A4648594)	Module	☒	☐	☒	☒	1	☐	☐	LTD 01/13 /2026
1st At Main Entrance Right One, 11:31:32AM 01/13/2026 (A4648595)	Module	☒	☐	☒	☒	1	☐	☐	LTD 01/13 /2026
1st At Office, 11:01:13AM 02/10/2026 (A4648650)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/10 /2026
1st At Office, 11:01:48AM 02/10/2026 (A4648651)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/10 /2026
1st At Office, 11:01:55AM 02/10/2026 (A4648652)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/10 /2026
1st At Office, 11:02:29AM 02/10/2026 (A4648653)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/10 /2026
1st At Office, 11:02:36AM 02/10/2026 (A4648654)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/10 /2026
1st At Office, 11:03:03AM 02/10/2026 (A4648655)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/10 /2026
1st At Office, 11:03:47AM 02/10/2026 (A4648658)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/10 /2026
1st At Office, 11:03:56AM 02/10/2026 (A4648659)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/10 /2026

Location	Device Type	Correctly Installed	Requires Service, Repairs, Cleaning or Missing	Alarm Operation Confirmed	Annunciation Indication Confirmed	Zone Circuit Number or Address	Supervision of Wiring Device Confirmed	Ground Circuit Confirmed	Remarks/ Readings
1st At Office, 11:04:41AM 02/10/2026 (A4648664)	System Documents	☒	☐	☐	☐	1	☐	☐	LTD 02/10 /2026
1st Beside Stairwell, 11:23:46AM 01/13/2026 (A4WF591)	Smoke Detector	☒	☐	☒	☒	1-2 N/A	☐	☐	2.3, LTD 01 /13/2026
1st Beside Stairwell, 11:51:48AM 01/13/2026 (A4648599)	Smoke Alarm	☒	☐	☐	☐	1-N/A	☐	☐	LTD 01/13 /2026
1st Inside FACP, 3:56:06PM 01/13/2026 (A4648621)	Battery	☒	☐	☐	☐	1-N/A N/A	☐	☐	LTD 01/13 /2026
1st Inside FACP, 3:56:42PM 01/13/2026 (A4648670)	Damper Control	☒	☐	☒	☐	1-N/A N/A	☐	☐	LTD 01/13 /2026
1st Inside FACP, 3:56:10PM 01/13/2026 (A4648667)	Emergency Power Supply	☐	☐	☐	☐	1-N/A N/A	☐	☐	LTD 01/13 /2026
1st Inside FACP, 3:58:31PM 01/13/2026 (A4648669)	Locking Device, Magnetic Lock	☒	☐	☒	☐	1-N/A N/A	☐	☐	LTD 01/13 /2026
1st Inside Fireplace Room, 11:55:37AM 01/13/2026 (A4648602)	Smoke Detector	☒	☐	☒	☒	1-2 N/A	☐	☐	2.3, LTD 01 /13/2026
1st Inside Fireplace Room, 11:56:12AM 01/13/2026 (A4648604)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
1st Inside Fireplace Room, 11:55:47AM 01/13/2026 (A4648603)	Smoke Alarm	☒	☐	☐	☐	1-N/A	☐	☐	LTD 01/13 /2026
1st Inside Fireplace Room Inside Bedroom, 11:50:57AM 01/13 /2026 (A4648598)	Smoke Detector	☒	☐	☒	☒	1-2 N/A	☐	☐	2.3, LTD 01 /13/2026
1st Inside Fireplace Room Inside Bedroom, 11:56:34AM 01/13 /2026 (A4648605)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
1st Inside Garage, 3:56:01PM 01/13/2026 (A4648671)	Monitoring	☒	☐	☒	☒	1-N/A N/A	☐	☐	LTD 01/13 /2026
1st Inside Kitchen, 11:35:56AM 01/13/2026 (A4648596)	Pull Station	☒	☐	☒	☒	1-2 N/A	☐	☐	LTD 01/13 /2026
1st Inside Kitchen, 11:57:02AM 01/13/2026 (A4648606)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
1st Inside Laundry Room, 11:46:12AM 01/13/2026 (A4648597)	Pull Station	☒	☐	☒	☒	1-2 N/A	☐	☐	LTD 01/13 /2026
1st Inside Laundry Room, 11:52:42AM 01/13/2026 (A4648600)	Smoke Detector	☒	☐	☒	☒	1-2 N/A	☐	☐	2.3, LTD 01 /13/2026
1st Inside Office, 11:57:37AM 01/13/2026 (A4648608)	Smoke Detector	☒	☐	☒	☒	1-2 N/A	☐	☐	2.3, LTD 01 /13/2026
1st Inside Office, 11:57:18AM 01/13/2026 (A4648607)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
1st Inside Office Living Space, 11:57:59AM 01/13/2026 (A4648609)	Smoke Detector	☒	☐	☒	☒	1-2 N/A	☐	☐	2.3, LTD 01 /13/2026

Location	Device Type	Correctly Installed	Requires Service, Repairs, Cleaning or Missing	Alarm Operation Confirmed	Annunciation Indication Confirmed	Zone Circuit Number or Address	Supervision of Wiring Device Confirmed	Ground Circuit Confirmed	Remarks/ Readings
1st Inside Office Living Space, 11:58:23AM 01/13/2026 (A4648610)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
1st Outside Washroom, 2:05:34PM 01/13/2026 (A4648611)	End Of Line	☒	☐	☒	☒	1-2 N/A	☒	☒	LTD 01/13 /2026
1st Outside Washroom, 11:53:12AM 01/13/2026 (A4648601)	Smoke Detector	☒	☐	☒	☒	1-2 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Beside Stairwell, 10:59:52AM 01/13/2026 (A4648589)	End Of Line	☒	☐	☒	☒	1-4 N/A	☒	☒	LTD 01/13 /2026
2nd Beside Stairwell, 10:35:41AM 01/13/2026 (A4648572)	Smoke Detector	☒	☐	☒	☒	1-4 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Beside Stairwell, 10:47:47AM 01/13/2026 (A4648588)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
2nd Inside East End Bedroom, 10:42:28AM 01/13/2026 (A4648581)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Inside East End Bedroom, 10:42:55AM 01/13/2026 (A4648582)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
2nd Inside East End Bedroom Closet, 10:44:43AM 01/13/2026 (A4648585)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Inside East End Entrance Room Closet, 10:12:10AM 01/13 /2026 (91076915)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Inside East End Larger Storage Room, 10:12:49AM 01/13 /2026 (91076919)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Inside East End Larger Storage Room, 10:14:54AM 01/13 /2026 (91076917)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
2nd Inside East End Larger Storage Room Closet, 10:49:15AM 01/13/2026 (91076916)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Inside East End Living Room, 10:42:01AM 01/13/2026 (A4648580)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Inside East End Living Room, 10:41:35AM 01/13/2026 (A4648579)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
2nd Inside East End Smaller Storage Room, 10:15:28AM 01/13 /2026 (91076914)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Inside East End Smaller Storage Room, 10:16:18AM 01/13 /2026 (91076913)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
2nd Inside East End Vestibule, 11:22:34AM 01/13/2026 (A4648587)	Smoke Alarm	☒	☐	☐	☐	1-N/A N/A	☐	☐	LTD 01/13 /2026
2nd Inside East End Vestibule, 10:43:24AM 01/13/2026 (A4648583)	Pull Station	☒	☐	☒	☒	1-3 N/A	☐	☐	LTD 01/13 /2026
2nd Inside East End Vestibule, 10:45:26AM 01/13/2026 (A4648586)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026

Location	Device Type	Correctly Installed	Requires Service, Repairs, Cleaning or Missing	Alarm Operation Confirmed	Annunciation Indication Confirmed	Zone Circuit Number or Address	Supervision of Wiring Device Confirmed	Ground Circuit Confirmed	Remarks/ Readings
2nd Inside West End Bedroom, 10:39:31AM 01/13/2026 (A4648578)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Inside West End Bedroom, 10:39:01AM 01/13/2026 (A4648577)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
2nd Inside West End Bedroom Closet, 10:44:01AM 01/13/2026 (A4648584)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Inside West End Entrance Room, 11:15:00AM 01/13/2026 (A4648590)	End Of Line	☒	☐	☒	☒	1-3 N/A	☒	☒	LTD 01/13 /2026
2nd Inside West End Living Room, 10:38:31AM 01/13/2026 (A4648576)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026
2nd Inside West End Living Room, 10:37:44AM 01/13/2026 (A4648575)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026
2nd Inside West End Vestibule, 10:36:22AM 01/13/2026 (A4648573)	Pull Station	☒	☐	☒	☒	1-3 N/A	☐	☐	LTD 01/13 /2026
2nd Inside West End Vestibule, 10:36:57AM 01/13/2026 (A4648574)	Smoke Detector	☒	☐	☒	☒	1-3 N/A	☐	☐	2.3, LTD 01 /13/2026
Garage, 11:47:13AM 01/13/2026 (91076880)	Horn/Strobe	☒	☐	☒	☐	1-N/A	☐	☐	LTD 01/13 /2026

Inspection & Testing

Generated by: BuildingReports.ca

Building: Kerry's Place		Control Panel: 1 - Mircom FA-1000		
<i>The Inspection & Testing section lists all of the items inspected in your building. Items are grouped by Passed or Failed/Other. Items are listed by Category. Each item includes the services performed, and the time & date at which testing occurred.</i>				
Device Type	Location	Service	Time	Date
Passed				
Auxiliary				
Damper Control	1st Inside FACP	Tested	3:56:42 PM	01/13/2026
Locking Device	1st Inside FACP	Tested	3:58:31 PM	01/13/2026
Control				
Battery	1st Inside FACP	Tested	3:56:06 PM	01/13/2026
Control Panel	1st At Main Entrance	Tested	3:50:10 PM	01/13/2026
Emergency Power Supply	1st Inside FACP	Tested	3:56:10 PM	01/13/2026
System Documents	1st At FACP	Visually Checked	11:30:31 AM	02/18/2026
System Documents	1st At FACP	Visually Checked	11:32:01 AM	02/18/2026
System Documents	1st At FACP	Visually Checked	11:32:54 AM	02/18/2026
System Documents	1st At FACP	Visually Checked	11:34:42 AM	02/18/2026
System Documents	1st At FACP	Visually Checked	8:37:25 PM	02/24/2026
System Documents	1st At FACP	Visually Checked	8:37:34 PM	02/24/2026
System Documents	1st At FACP	Visually Checked	8:37:39 PM	02/24/2026
System Documents	1st At Office	Visually Checked	11:01:13 AM	02/10/2026
System Documents	1st At Office	Visually Checked	11:01:48 AM	02/10/2026
System Documents	1st At Office	Visually Checked	11:01:55 AM	02/10/2026
System Documents	1st At Office	Visually Checked	11:02:29 AM	02/10/2026
System Documents	1st At Office	Visually Checked	11:02:36 AM	02/10/2026
System Documents	1st At Office	Visually Checked	11:03:03 AM	02/10/2026
System Documents	1st At Office	Visually Checked	11:03:47 AM	02/10/2026
System Documents	1st At Office	Visually Checked	11:03:56 AM	02/10/2026
System Documents	1st At Office	Visually Checked	11:04:41 AM	02/10/2026
Indicating				
Horn/Strobe	Basement Inside Larger Living Room	Tested	2:08:35 PM	01/13/2026
Horn/Strobe	Basement Inside Larger Living Room Inside Bedroom	Tested	2:06:18 PM	01/13/2026
Horn/Strobe	Basement Inside Smaller Living Room	Tested	2:10:10 PM	01/13/2026

Device Type	Location	Service	Time	Date
<i>Passed</i>				
Horn/Strobe	Basement Inside Smaller Living Room Inside Bedroom	Tested	2:09:34 PM	01/13/2026
Horn/Strobe	1st Inside Fireplace Room	Tested	11:56:12 AM	01/13/2026
Horn/Strobe	1st Inside Fireplace Room Inside Bedroom	Tested	11:56:34 AM	01/13/2026
Horn/Strobe	1st Inside Kitchen	Tested	11:57:02 AM	01/13/2026
Horn/Strobe	1st Inside Office	Tested	11:57:18 AM	01/13/2026
Horn/Strobe	1st Inside Office Living Space	Tested	11:58:23 AM	01/13/2026
Horn/Strobe	2nd Beside Stairwell	Tested	10:47:47 AM	01/13/2026
Horn/Strobe	2nd Inside East End Bedroom	Tested	10:42:55 AM	01/13/2026
Horn/Strobe	2nd Inside East End Larger Storage Room	Tested	10:14:54 AM	01/13/2026
Horn/Strobe	2nd Inside East End Living Room	Tested	10:41:35 AM	01/13/2026
Horn/Strobe	2nd Inside East End Smaller Storage Room	Tested	10:16:18 AM	01/13/2026
Horn/Strobe	2nd Inside West End Bedroom	Tested	10:39:01 AM	01/13/2026
Horn/Strobe	2nd Inside West End Living Room	Tested	10:37:44 AM	01/13/2026
Horn/Strobe	Garage	Tested	11:47:13 AM	01/13/2026
Initiating				
Duct Detector	Basement Above Ceiling Larger Living Room Duct #6	Tested	1:25:27 PM	01/13/2026
Duct Detector	Basement Inside AHU Room Duct #1	Tested	1:50:31 PM	01/13/2026
Duct Detector	Basement Inside AHU Room Duct #2	Tested	1:45:57 PM	01/13/2026
Duct Detector	Basement Inside AHU Room Duct #3	Tested	1:48:24 PM	01/13/2026
Duct Detector	Basement Inside AHU Room Duct #4	Tested	1:56:50 PM	01/13/2026
Duct Detector	Basement Inside AHU Room Duct #5	Tested	1:54:55 PM	01/13/2026
Pull Station	Basement Beside Emergency Exit	Tested	1:32:12 PM	01/13/2026
Pull Station	Basement Inside Larger Living Room	Tested	1:08:59 PM	01/13/2026
Pull Station	Basement Outside Bathroom	Tested	1:35:09 PM	01/13/2026
Pull Station	1st At Main Entrance	Tested	11:26:50 AM	01/13/2026
Pull Station	1st Inside Kitchen	Tested	11:35:56 AM	01/13/2026
Pull Station	1st Inside Laundry Room	Tested	11:46:12 AM	01/13/2026
Pull Station	2nd Inside East End Vestibule	Tested	10:43:24 AM	01/13/2026
Pull Station	2nd Inside West End Vestibule	Tested	10:36:22 AM	01/13/2026
Smoke Alarm	Basement Inside Larger Living Room	Tested	1:18:22 PM	01/13/2026
Smoke Alarm	Basement Inside Larger Living Room	Tested	2:07:47 PM	01/13/2026
Smoke Alarm	Basement Inside Smaller Living Room Outside Bathroom	Tested	2:12:11 PM	01/13/2026
Smoke Alarm	1st Beside Stairwell	Tested	11:51:48 AM	01/13/2026
Smoke Alarm	1st Inside Fireplace Room	Tested	11:55:47 AM	01/13/2026
Smoke Alarm	2nd Inside East End Vestibule	Tested	11:22:34 AM	01/13/2026

Device Type	Location	Service	Time	Date
<i>Passed</i>				
Smoke Detector	Basement Above Emergency Exit	Tested/Cleaned	1:33:38 PM	01/13/2026
Smoke Detector	Basement Inside AHU Room	Tested/Cleaned	1:44:56 PM	01/13/2026
Smoke Detector	Basement Inside Bedroom Closet	Tested/Cleaned	1:37:19 PM	01/13/2026
Smoke Detector	Basement Inside Larger Living Room	Tested/Cleaned	2:08:08 PM	01/13/2026
Smoke Detector	Basement Inside Larger Living Room Inside Bedroom	Tested/Cleaned	2:07:18 PM	01/13/2026
Smoke Detector	Basement Inside Smaller Living Room Above Kitchen	Tested/Cleaned	2:12:57 PM	01/13/2026
Smoke Detector	Basement Inside Smaller Living Room Inside Bedroom	Tested/Cleaned	2:09:00 PM	01/13/2026
Smoke Detector	Basement Inside Sprinkler Room	Tested/Cleaned	2:13:25 PM	01/13/2026
Smoke Detector	Basement Inside Stairwell	Tested/Cleaned	2:05:54 PM	01/13/2026
Smoke Detector	1st Beside Stairwell	Tested/Cleaned	11:23:46 AM	01/13/2026
Smoke Detector	1st Inside Fireplace Room	Tested/Cleaned	11:55:37 AM	01/13/2026
Smoke Detector	1st Inside Fireplace Room Inside Bedroom	Tested/Cleaned	11:50:57 AM	01/13/2026
Smoke Detector	1st Inside Laundry Room	Tested/Cleaned	11:52:42 AM	01/13/2026
Smoke Detector	1st Inside Office	Tested/Cleaned	11:57:37 AM	01/13/2026
Smoke Detector	1st Inside Office Living Space	Tested/Cleaned	11:57:59 AM	01/13/2026
Smoke Detector	1st Outside Washroom	Tested/Cleaned	11:53:12 AM	01/13/2026
Smoke Detector	2nd Beside Stairwell	Tested/Cleaned	10:35:41 AM	01/13/2026
Smoke Detector	2nd Inside East End Bedroom	Tested/Cleaned	10:42:28 AM	01/13/2026
Smoke Detector	2nd Inside East End Bedroom Closet	Tested/Cleaned	10:44:43 AM	01/13/2026
Smoke Detector	2nd Inside East End Entrance Room Closet	Tested/Cleaned	10:12:10 AM	01/13/2026
Smoke Detector	2nd Inside East End Larger Storage Room	Tested/Cleaned	10:12:49 AM	01/13/2026
Smoke Detector	2nd Inside East End Larger Storage Room Closet	Tested/Cleaned	10:49:15 AM	01/13/2026
Smoke Detector	2nd Inside East End Living Room	Tested/Cleaned	10:42:01 AM	01/13/2026
Smoke Detector	2nd Inside East End Smaller Storage Room	Tested/Cleaned	10:15:28 AM	01/13/2026
Smoke Detector	2nd Inside East End Vestibule	Tested/Cleaned	10:45:26 AM	01/13/2026
Smoke Detector	2nd Inside West End Bedroom	Tested/Cleaned	10:39:31 AM	01/13/2026
Smoke Detector	2nd Inside West End Bedroom Closet	Tested/Cleaned	10:44:01 AM	01/13/2026
Smoke Detector	2nd Inside West End Living Room	Tested/Cleaned	10:38:31 AM	01/13/2026
Smoke Detector	2nd Inside West End Vestibule	Tested/Cleaned	10:36:57 AM	01/13/2026
Monitor				
Module	1st At Main Entrance Left One	Tested	11:30:53 AM	01/13/2026
Module	1st At Main Entrance Middle One	Tested	11:31:22 AM	01/13/2026
Module	1st At Main Entrance Right One	Tested	11:31:32 AM	01/13/2026
Monitoring	1st Inside Garage	Tested	3:56:01 PM	01/13/2026
Supervisory				

Device Type	Location	Service	Time	Date
<i>Passed</i>				
End Of Line	Basement Above Ceiling Larger Living Room Duct #6	Tested	1:26:10 PM	01/13/2026
End Of Line	Basement Beside Emergency Exit	Tested	1:33:45 PM	01/13/2026
End Of Line	Basement Inside AHU Room	Tested	1:44:51 PM	01/13/2026
End Of Line	Basement Inside AHU Room	Tested	1:50:47 PM	01/13/2026
End Of Line	Basement Inside Stairwell	Tested	2:03:54 PM	01/13/2026
End Of Line	1st Outside Washroom	Tested	2:05:34 PM	01/13/2026
End Of Line	2nd Beside Stairwell	Tested	10:59:52 AM	01/13/2026
End Of Line	2nd Inside West End Entrance Room	Tested	11:15:00 AM	01/13/2026

Auxiliary Functions Testing

Generated by: BuildingReports.ca

Building: Kerry's Place		Control Panel: 1 - Mircom FA-1000		
<i>The Auxiliary Functions Testing section lists each of the ancillary items, systems, and emergency equipment that are controlled by the system control unit. Items are grouped by Passed or Failed/Other. The items are listed by device type, and a check box is provided to indicate if the test conducted was simulated.</i>				
Type	Location	Comment	ScanID	Simulated
Passed				
Damper Control				
	1st Inside FACP	Passed	A4648670	☒
Locking Device				
Magnetic Lock	1st Inside FACP	Passed	A4648669	☒
Duct Detector				
AHU Shutdown	Basement Above Ceiling Larger Living Room Duct #6	Passed	91076929	
AHU Shutdown	Basement Inside AHU Room Duct #1	Passed	91076757	
AHU Shutdown	Basement Inside AHU Room Duct #2	Passed	91076754	
AHU Shutdown	Basement Inside AHU Room Duct #3	Passed	91076756	
AHU Shutdown	Basement Inside AHU Room Duct #4	Passed	91076930	
AHU Shutdown	Basement Inside AHU Room Duct #5	Passed	91076758	

Sensitivity Testing

Generated by: BuildingReports.ca

Building: Kerry's Place			Control Panel: 1 - Mircom FA-1000		
<i>The Sensitivity Testing section details the sensitivity test ranges and acceptable readings for each type of device. Items are grouped by Passed or Failed/Other. Normally, Devices that perform outside the acceptable range of sensitivity are listed in Failed/Other.</i>					
Location	Address	Model #	Range	Value	ScanID
Passed					
Duct Detector					
Basement Above Ceiling Larger Living Room Duct #6	1-14 N/A	2D51A			91076929
Basement Inside AHU Room Duct #1	1-9 N/A	2D51A			91076757
Basement Inside AHU Room Duct #2	1-10 N/A	2D51A			91076754
Basement Inside AHU Room Duct #3	1-11 N/A	2D51A			91076756
Basement Inside AHU Room Duct #4	1-12 N/A	2D51A			91076930
Basement Inside AHU Room Duct #5	1-13 N/A	2D51A			91076758
Device Total: 6					
Smoke Detector					
Basement Above Emergency Exit	1-6 N/A	C2W-BA	1.0 - 4.0	2.3	91076763
Basement Inside AHU Room	1-7 N/A	C2W-BA	1.0 - 4.0	2.3	91076752
Basement Inside Bedroom Closet	1-1 N/A	C2W-BA	1.0 - 4.0	2.3	91076764
Basement Inside Larger Living Room	1-1 N/A	C2W-BA	1.0 - 4.0	2.3	A4648616
Basement Inside Larger Living Room Inside Bedroom	1-1 N/A	C2W-BA	1.0 - 4.0	2.3	A4648614
Basement Inside Smaller Living Room Above Kitchen	1-1 N/A	C2W-BA	1.0 - 4.0	2.3	A4648628
Basement Inside Smaller Living Room Inside Bedroom	1-1 N/A	C2W-BA	1.0 - 4.0	2.3	A4648618
Basement Inside Sprinkler Room	1-1 N/A	C2W-BA	1.0 - 4.0	2.3	A4648629
Basement Inside Stairwell	1-5 N/A	C2W-BA	1.0 - 4.0	2.3	A4648612
1st Beside Stairwell	1-2 N/A	C2W-BA	1.0 - 4.0	2.3	A4WF591
1st Inside Fireplace Room	1-2 N/A	C2W-BA	1.0 - 4.0	2.3	A4648602
1st Inside Fireplace Room Inside Bedroom	1-2 N/A	C2W-BA	1.0 - 4.0	2.3	A4648598
1st Inside Laundry Room	1-2 N/A	C2W-BA	1.0 - 4.0	2.3	A4648600
1st Inside Office	1-2 N/A	C2W-BA	1.0 - 4.0	2.3	A4648608
1st Inside Office Living Space	1-2 N/A	C2W-BA	1.0 - 4.0	2.3	A4648609
1st Outside Washroom	1-2 N/A	C2W-BA	1.0 - 4.0	2.3	A4648601
2nd Beside Stairwell	1-4 N/A	C2W-BA	1.0 - 4.0	2.3	A4648572
2nd Inside East End Bedroom	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	A4648581
2nd Inside East End Bedroom Closet	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	A4648585

Location	Address	Model #	Range	Value	ScanID
2nd Inside East End Entrance Room Closet	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	91076915
2nd Inside East End Larger Storage Room	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	91076919
2nd Inside East End Larger Storage Room Closet	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	91076916
2nd Inside East End Living Room	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	A4648580
2nd Inside East End Smaller Storage Room	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	91076914
2nd Inside East End Vestibule	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	A4648586
2nd Inside West End Bedroom	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	A4648578
2nd Inside West End Bedroom Closet	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	A4648584
2nd Inside West End Living Room	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	A4648576
2nd Inside West End Vestibule	1-3 N/A	C2W-BA	1.0 - 4.0	2.3	A4648574
Device Total: 29					

Air Flow Testing

Generated by: BuildingReports.ca

Building: Kerry's Place

Control Panel: 1 - Mircom FA-1000

The Air Flow Testing report details the test measurements of Air Duct type smoke detectors. Items are grouped by Passed or Failed/Other. Pressure and velocity test readings are recorded and compared with acceptable results. Normally, Device readings that fall outside the range of acceptance are listed in Failed/Other.

Location	Scan ID	Model	Ins/H2O	Ft/Min	Ins/H2O Range	Ft/Min Range
<i>Passed</i>						
Duct Detector						
Basement Above Ceiling Larger Living Room Duct #6	91076929	2D51A	0.33			
Basement Inside AHU Room Duct #1	91076757	2D51A	0.33			
Basement Inside AHU Room Duct #2	91076754	2D51A	0.31			
Basement Inside AHU Room Duct #3	91076756	2D51A	0.32			
Basement Inside AHU Room Duct #4	91076930	2D51A	0.29			
Basement Inside AHU Room Duct #5	91076758	2D51A	0.28			

Smoke Alarms

Generated by: BuildingReports.ca

Building: Kerry's Place

The smoke alarm report details the inspection of smoke alarms.

Scan ID	Location	Type	Voltage	Mfr. Date
Passed				
A4648623	Basement Inside Larger Living Room	Ionization	9V	04/25/2025
A4648615	Basement Inside Larger Living Room	Combo SA/CO	110V/Bat	06/09/2023
A4648627	Basement Inside Smaller Living Room Outside Bathroom	Combo SA/CO	110V/Bat	09/21/2020
A4648599	1st Beside Stairwell	Combo SA/CO	110V/Bat	06/07/2022
A4648603	1st Inside Fireplace Room	Combo SA/CO	110V/Bat	06/07/2022
A4648587	2nd Inside East End Vestibule	Combo SA/CO	110V/Bat	12/14/2020

Inventory & Warranty Report

Generated by: BuildingReports.ca

Building: Kerry's Place				Control Panel: 1 - Mircom FA-1000	
<i>The Inventory & Warranty Report lists each of the devices and items that are included in your Inspection Report. A complete inventory count by device type and category is provided. Items installed within the last 90 days, within the last year, and devices installed for two years or more are grouped together for easy reference.</i>					
Device or Type		Category		% of Inventory	Quantity
Battery		Control		1.01%	1
Control Panel		Control		1.01%	1
Damper Control		Auxiliary		1.01%	1
Duct Detector		Initiating		6.06%	6
Emergency Power Supply		Control		1.01%	1
End Of Line		Supervisory		8.08%	8
Horn/Strobe		Indicating		17.17%	17
Locking Device		Auxiliary		1.01%	1
Module		Monitor		3.03%	3
Monitoring		Monitor		1.01%	1
Pull Station		Initiating		8.08%	8
Smoke Alarm		Initiating		6.06%	6
Smoke Detector		Initiating		29.29%	29
System Documents		Control		16.16%	16
Type	Qty	Model #	Description		Install Date
New (under 90 days)					
Idealpower					
Battery	1	2x 12V 12Ah	Sealed Lead Acid		01/13/2026
Emergency Power Supply	1	2x 12V 12Ah	Batteries		01/13/2026
In Service - 1 Year to 2 Years					
Mircom					
End Of Line	8	3.9K			03/06/2024
Horn/Strobe	17	FHS-400-RR			03/06/2024
Module	3	MIX-4050	Sync Module		03/06/2024
System Sensor					
Duct Detector	6	2D51A	Photoelectric		03/06/2024
Smoke Detector	29	C2W-BA	Photoelectric		03/06/2024
In Service - 2 Years to 3 Years					
Kidde					
Smoke Alarm	1	P4010ACLEDSCOCA-	Combo SA/CO		06/10/2023
2					
In Service - 3 Years to 5 Years					
Siemens					

Pull Station	1	500-637080-C	Keyed	10/01/2022
Kidde				
Smoke Alarm	2	P4010ACLEDSCOCA- 2	Combo SA/CO	06/08/2022
Smoke Alarm	1	30CUA10-VCA	Ionization	09/14/2021
Siemens				
Pull Station	1	500-637080C	Keyed	07/16/2021
Pull Station	6	500-698220C	Keyed	07/16/2021
<i>In Service - 5 Years to 10 Years</i>				
DSC				
Monitoring	1	HS2032	Alarm/Trouble/Supervisory	01/01/2021
Mircom				
Control Panel	1	FA-1000	Conventional	01/01/2021
Damper Control	1			01/01/2021
Locking Device	1		Magnetic Lock	01/01/2021
System Documents	1	FA-1000	Alarm Signal Operation	01/01/2021
System Documents	1	FA-1000	Ancillary Controls	01/01/2021
System Documents	1	FA-1000	DWG As-Built FA System	01/01/2021
System Documents	1	FA-1000	DWG Smoke Control Type	01/01/2021
System Documents	1	FA-1000	FA Modifications	01/01/2021
System Documents	1	FA-1000	FA Operating Instructions	01/01/2021
System Documents	1	FA-1000	FA Sequence of Operation	01/01/2021
System Documents	1	FA-1000	FA System Software	01/01/2021
System Documents	1	FA-1000	FACU Operating Ctrl's & Indic.	01/01/2021
System Documents	1	FA-1000	Fire Signal Rcvg Centre Conn.	01/01/2021
System Documents	1	FA-1000	Fire Zone Listing	01/01/2021
System Documents	1	FA-1000	Previous Verification Report	01/01/2021
System Documents	1	FA-1000	Reset & Silence	01/01/2021
System Documents	1	FA-1000	Shop Drawings	01/01/2021
System Documents	1	FA-1000	Smoke Control Sequence	01/01/2021
System Documents	1	FA-1000	Trouble Silence	01/01/2021
Kidde				
Smoke Alarm	1	P4010ACLEDSCOCA- 2	Combo SA/CO	12/15/2020
Smoke Alarm	1	P4010ACLEDSCOCA- 2	Combo SA/CO	09/22/2020